


Product Description

- 10-32VDC Input
- Internal RC/MOV Protection Circuit
- RoHS Compliant





Ordering Information

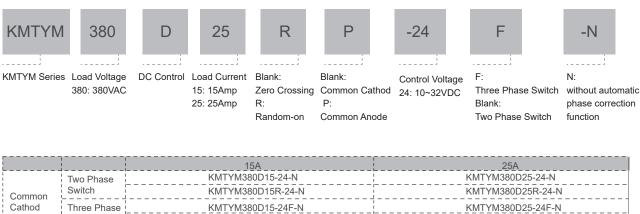

1	Catilou	THIEE FHASE		
L		Switch	KMTYM380D15R-24F-N	KMTYM380D25R-24F-N
	Common Anode	Two Phase Switch	KMTYM380D15P-24-N	KMTYM380D25P-24-N
			KMTYM380D15RP-24-N	KMTYM380D25RP-24-N
		Three Phase	KMTYM380D15P-24F-N	KMTYM380D25P-24F-N
		Switch	KMTYM380D15RP-24F-N	KMTYM380D25RP-24F-N

General Specifications

Input Specifications (Ta=25°C)				
Control Voltage Range	10-32VDC			
Must Turn-on Voltage	10VDC			
Must Turn-off Voltage	4VDC			
Nacional Inc. 4 Comment	Common Cathod	35mA@32VDC		
Maximum Input Current	Common Anode	18mA@32VDC		
Delay Conduction Time (Typical)		80±10ms		



General Specifications

Dutput Specifications (Ta=25°C)				
Load Voltage Range	24-440VAC			
Maximum Transient Overvoltage	800Vpk			
Minimum Load Current	100mA			
Maximum Turn-off Time	20ms			
Maximum Surray Current (@10ma)	15A		150A	
Maximum Surge Current (@10ms)	25A		250A	
Maximum Off-State Leakage Current@Rated Load Voltage	5mA			
Maximum On-State Voltage Drop@Rated Current		1.7Vrms		
Minimum Off-State dv/dt@Maximum Rated Voltage	200V/µs			


General Specifications (Ta=25°C)	neral Specifications (Ta=25°C)			
Dielectric Strength (50/60Hz)	Input/Output	4000Vrms		
	Input, output/Base	2500Vrms		
Minimum Insulation Resistance (@500VDC)	1000ΜΩ			
Ambient Temperature Range	-30°C \sim +80°C			
Storage Temperature Range	-30°C \sim +100°C			
Pulse Immunity Level	IEC61000-4-4	4kV/100kHz		
Surge Immunity Level	IEC61000-4-5	2kV/common mould, 1kV/different mould		
Electrostatic Discharge Immunity Level	IEC61000-4-2	4kV/contact discharge, 8kV/air discharge		

General Specifications (Ta=25°C)						
Weight (Typical)	180g					
Working Status Indication	LED1	Forward Indication				
	LED2	Reverse Indication				
	LED3	Three-phase Power Status Indication				

Applications

Three phase motor reversing control, such as the valve controls, and etc.

Outline Dimensions

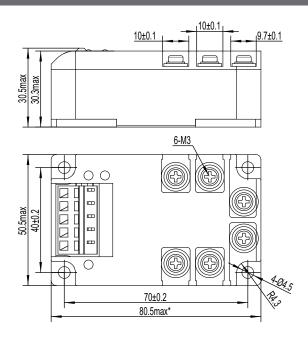


Rev.4.1,01-29-2023 Specifications are subject to change without notice. For any questions, please contact our technical support. Please visit us at www.i-autoc.com Copyright © 2023 Xiamen Kudom Electronics Technology Co.,Ltd.





Wiring Diagram

Common Cathode

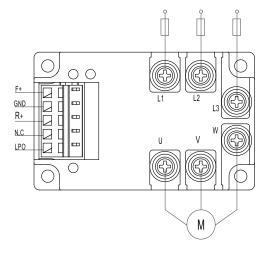

Wiring Instructions:

F+: Forwarding control should input anode;

GND: Control power supply should connect with cathode;

R+: Reversing control should input anode;

N.C.: No Connection


LPO: Phase loss output, high impedance status

when there is phase loss in three-phase electricity.

Max. output current is 50mA;

Note: there is no connection wire in LPO terminal when the product does not have phase loss protection or automatic phase correction function.

Common Anode

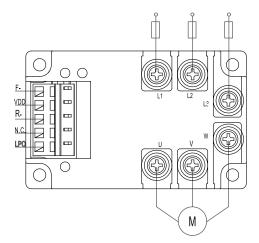


Wiring Instructions:

F-: Forwarding control should input cathode;
VDD: Control power supply should connect with anode,10-32VDC;
R-: Reversing control should input cathode;
N.C.: No Connection
LPO: Phase loss output, high impedance status
when there is phase loss in three-phase electricity.
Max. output current is 50mA;
Note: there is no connection wire in LPO terminal when the
product does not have phase loss protection or automatic

phase correction function.

Thermal Derating Curve

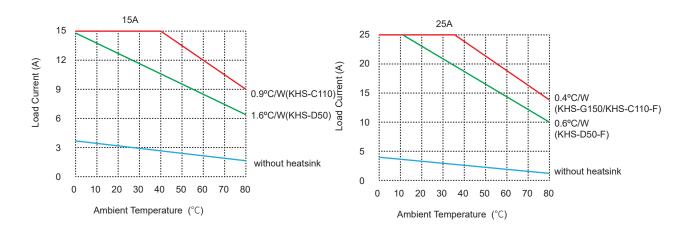

Rev.4.1,01-29-2023 Specifications are subject to change without notice. For any questions, please contact our technical support. Please visit us at www.i-autoc.com Copyright © 2023 Xiamen Kudom Electronics Technology Co.,Ltd.





General Notes

1. Relay must be mounted to proper sized heat sink based on thermal curves. Thermal grease or a thermal pad must be used between relay.

2. When connecting wiring to SSR please ensure screws are torqued down properly. Recommended torque for output screw is (8.67-12.12)/(0.98-1.37) in-lb/N·m.

- 3. When the operation temperature is above 25 °C, please consider the derating as per the Thermal Derating Curve.
- 4. Please ensure reliable grounding when using the SSR.

Warnings

- 1. The product's side panels may be hot, allow the product to cool before touching.
- 2. Disconnect all power before installing or working with this equipment.
- 3. Verify all connections and replace all covers before turning on power.

