

Product Description

Transistor Output

Control Voltage: 4-32VDC ◆ Load Voltage: 100VDC

◆ Load Current: 3A

Dielectric Strength: 2500Vrms

 RoHS Compliant Plug in installation

Optional base mounting

Normally Closed Type







Customized Code



Ordering Information

General Specifications

KSODB













KSODB Series

Load Voltage 100:100VDC

DC Control Load Current

3:3Amp

Control Voltage W: 4-32VDC

Accessories D: With the base

Blank: Without the base

Input Specifications (Ta=25°C)		
Control Voltage Range	4-32VDC	i
Must Turn-on Voltage	4VDC	
Must Turn-off Voltage	1.0VDC	
Maximum Input Current	25mA (@32VDC)	

Output Specifications (Ta=25°C)	
Maximum Transient Overvoltage	150Vpk
Load Voltage Range	3-100VDC
Load Current Range	0.1~3A
Maximum Surge Current (@10 ms)	15A
Maximum Turn-on Time	1ms
Maximum Turn-off Time	1ms
Maximum Off-State Leakage Current@Rated Load Voltage	0.1mA
Maximum On-State Voltage Drop@Rated Current	1.3VDC








General Specifications (Ta=25°C)					
Dielectric Strength (50/60Hz)	2500Vrms				
Minimum Insulation Resistance (@500VDC)	1000ΜΩ				
Ambient Temperature Range	-30°C ~ +80°C				
Storage Temperature Range	-30°C ∼ +100°C				
Weight (Typical)	Without the base		20g		
	With the base		50g		


Applications

It is suitable for the isolation and control of weak current to strong current, convenient for all kinds of computers and digital interfaces, widely used in various DC motors, DC power sources and various electromagnetic devices in the field of industrial automation.

Outline Dimensions

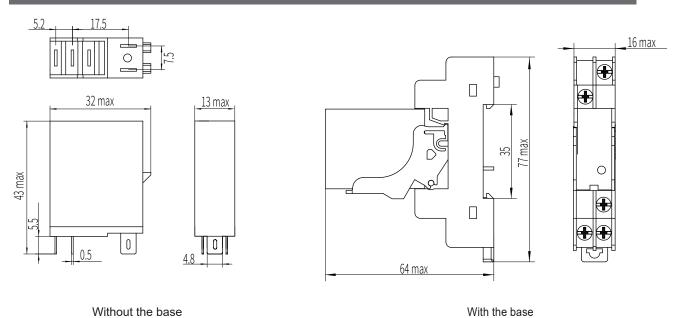

Wiring Diagram

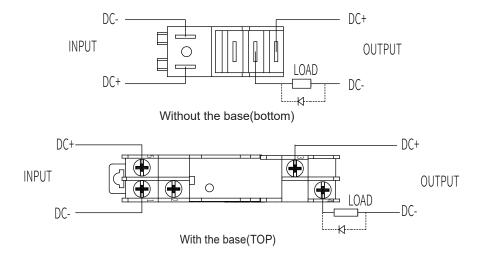











Thermal Derating Curve

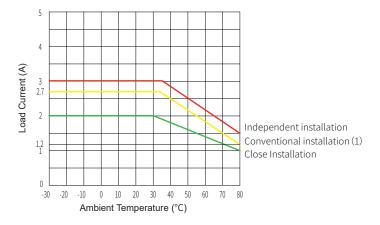

note (1): Conventional installation KSO distance:

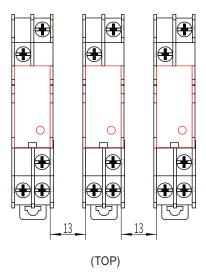

General Notes

- 1. Terminal polarity must be observed. Otherwise, it may cause damage to the relay.
- 2. When ambient temperature is above 25 C, the maximum load current decreases. See thermal derating curve.
- 3. When connection wiring to SSR, please ensure screws are torqued down properly. Recommended torque for screw is 8.8/1.0 in-lb/Nm.

! Warnings

- 1. The product's side panels may be hot, allow the product to cool before touching.
- 2. Disconnect all power before installing or working with this equipment.
- 3. Verify all connections and replace all covers before turning on power.



