

HG268 Three-angle gloss meter

- 3.5 inch super capacitive touch screen,full screen navigation shortcut menu
- Multiple sets of measurement data can be displayed at the same time, easy to compare
- Connect to PC ,more extend functions
- Super configuration of hardware,integrated multiple innovative technologies
- Automatic calibration ,convenient and quick



HG series automatic calibration type gloss meter


Gloss measurement so easy
with one-touch to complete!

PRODUCT FEATURES

1. 20°, 60° and 85° in one: from high to low gloss – have the specified angle on hand
2. Concise appearance, feel good
3. Display 5 sets of measurement data, good for comparison
4. Built-in lithium ion rechargeable battery
5. Basic model measurement can meet basic glossiness testing requirements
6. Connect to PC, more extend functions
7. One button for all angles measurement at the same location
8. Comply with international standards
9. Stable performance, easy to read data.
10. Optional accessories: micro printer; Easy to carry, without computer can be continuously printed out the measurement of various parameters, easy to save.



APPLICABLE INDUSTRIES

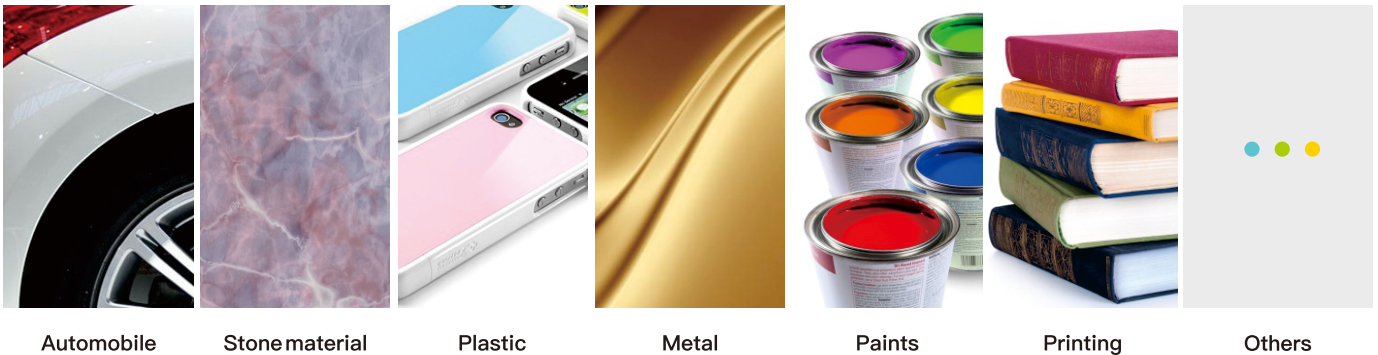

Automobile

Stonematerial

Plastic

Metal

Paints

Printing

Others

SPECIFICATION FEATURES

Measuring Angle: 20°/60°/85°

Comply with standard: ISO 2813, GB/T 9754, ASTM D 523, ASTM D 2457

Measuring Area (mm): 20°: 10x10 60°: 9x15 85°: 5x36

Measuring Range: 20°: 0~2000GU 60°: 0~1000GU 85°: 0~160GU

Division Value: 0.1GU

Measurement Range: 0-10GU 10-100GU 100-2000GU

Repeatability: ± 0.1GU ± 0.2GU ± 0.2%GU

Reproducibility: ± 0.2GU ± 0.5GU ± 0.5%GU

Measurement Standard: Conform with JJG696 first class glossmeter working requirement

Chromaticity Corresponding: Corresponding with CIE 1931(2°) under CIE C light source

Errors: ±1.5, ±1.5%

Measuring Time: 1.0s

Dimension: L*W*H : 160mm*75mm*90mm

Weight: 350g

Language: Chinese/English

Battery: 3200mAh Li-ion Battery

Display: TFT 3.5 inch

Interface: USB

Storage: Basic mode: 1000

Software: GQC6 Quality Control Software with QC report printing functions and more extended functions.

Operation Temperature: 0~40°C (32~104°F)

Storage Temperature: -20~50°C (-4~122°F)

Humidity: <85% relative humidity, no condensation

Standard Accessories: Power Adapter, USB cable, User Manual, CD (Including QC software), Calibration Plate

Optional Accessories: Miniature Printer